


| Properties | |
|----------------|----------------------------------|
| Connection 1 | BSP external thread, cylindrical |
| Sealing form 1 | 60° inner cone Shape A |
| Connection 2 | BSP cylindrical external threads |
| Sealing form 2 | 60° inner cone Shape A |
| Design | Connection sockets |
| Construction | straight |
| Material | Steel |
| Surface | electro galvanised |
| | |



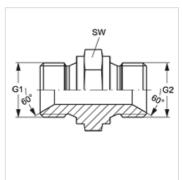

| Item | | | |
|--------------------------------|------------------------------|--------------------------|------------|
| Identification | G1 | G2 | AF |
| G HB 02 | G 1/8" -28 | G 1/8" -28 | (mm) 14 |
| G HB 02 HB 04 | G 1/8" -28 | G 1/4" -19 | 19 |
| G HB 02 HB 06 | G 1/8" -28 | G 3/8" -19 | 22 |
| G HB 02 HB 08 | G 1/8" -28 | G 1/2" -14 | 27 |
| G HB 04 | G 1/4" -19 | G 1/4" -19 | 19 |
| G HB 04 HB 06 | G 1/4" -19 | G 3/8" -19 | 22 |
| G HB 04 HB 08 | G 1/4" -19 | G 1/2" -14 | 27 |
| G HB 04 HB 10 | G 1/4" -19 | G 5/8" -14 | 30 |
| G HB 04 HB 12 | G 1/4" -19 | G 3/4" -14 | 32 |
| G HB 04 HB 16 | G 1/4" -19 | G 1" -11 | 41 |
| G HB 04 HB 20 | G 1/4" -19 | G 1.1/4" -11 | 50 |
| G HB 06 | G 3/8" -19 | G 3/8" -19 | 22 |
| G HB 06 HB 08 | G 3/8" -19 | G 1/2" -14 | 27 |
| G HB 06 HB 10 | G 3/8" -19 | G 5/8" -14 | 32 |
| G HB 06 HB 12 | G 3/8" -19 | G 3/4" -14 | 32 |
| G HB 06 HB 16 | G 3/8" -19 | G 1" -11 | 41 |
| G HB 06 HB 20 | G 3/8" -19 | G 1.1/4" -11 | 50 |
| G HB 08 | G 1/2" -14 | G 1/2" -14 | 27 |
| G HB 08 HB 10 | G 1/2" -14 | G 5/8" -14 | 30 |
| G HB 08 HB 12 | G 1/2" -14 | G 3/4" -14 | 32 |
| G HB 08 HB 16 | G 1/2" -14 | G 3/4 - 14 G 1" -11 | 41 |
| G HB 08 HB 20 | G 1/2" -14 | G 1.1/4" -11 | 50 |
| G HB 08 HB 24 | G 1/2" -14 | G 1.1/2" -11 | 55 |
| G HB 08 HB 32 | G 1/2" -14 | G 2" -11 | 70 |
| G HB 10 | G 5/8" -14 | G 5/8" -14 | 30 |
| | G 5/8" -14 | G 3/4" -14 | 32 |
| G HB 10 HB 12 G HB 10 HB 16 | G 5/8" -14 | G 3/4 - 14 G 1" -11 | 41 |
| G HB 10 HB 20 | G 5/8" -14 | G 1.1/4" -11 | 50 |
| G HB 12 | G 3/4" -14 | G 3/4" -14 | 32 |
| G HB 12 HB 16 | G 3/4" -14 | G 3/4 - 14 G 1" -11 | 41 |
| G HB 12 HB 20 | G 3/4" -14 | G 1.1/4" -11 | 50 |
| G HB 12 HB 24 | G 3/4" -14 | G 1.1/4 -11 | 55 |
| G HB 12 HB 32 | G 3/4" -14 | G 2" -11 | 70 |
| G HB 16 | G 1" -11 | G 1" -11 | 41 |
| G HB 16 HB 20 | G 1" | G 1.1/4" -11 | 50 |
| G HB 16 HB 24 | G 1" -11 | G 1.1/2" -11 | 55 |
| G HB 16 HB 32 | G 1" -11 | G 2" -11 | 70 |
| G HB 20 | G 1.1/4" -11 | G 1.1/4" -11 | 50 |
| | | | |
| G HB 20 HB 24 G HB 20 HB 32 | G 1.1/4" -11 G 1.1/4" -11 | G 1.1/2" -11 G 2" -11 | 55 70 |
| G HB 24 | G 1.1/2" -11 | G 2 -11 | 55 |
| G HB 24 HB 32 | G 1.1/2 -11 | G 2" -11 | 70 |
| G HB 32 | G 2" -11 | G 2" -11 | 70 |
| G HB 40 HB 48 | G 2.1/2" -11 | | |
| G HB 48 | G 2.1/2 -11 G 3" -11 | G 3" -11 G 3" -11 | 100 110 |
| G 11D 40 | G 3 - 1 1 | G3 -11 | 110 |

AF = Width across flats

| ъ. | | _ | | -4 | ve | | - | _ | _ |
|----|----|---|---|----|----|----|---|----|---|
| | ro | a | u | | ve | rs | Ю | 10 | |

G HB VA Connection sockets, Stainless steel