


Karakteristike

Posebna obilježja	Tvrdoća: oko 77° Shore A
Unutrašnji sloj	Meki PVC
Umetak	nema
Vanjski sloj	Meki PVC
Boja	prozirna
Temperatura min.	-5 °C
Temperatura max.	60 °C
Mediji	Voda zrak

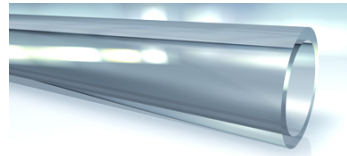

Napomena

Tlakovi se odnose na kratko tlačno opterećenje bez tlačnih udaraca na +20°C.

Artikli

Naziv	Unutarnji Ø (mm)	Vanjski Ø (mm)	Debljina stjenki (mm)	BD* kod 20°C (bar)	Duljina valjaka (m)
PSK 02-1	2	4	1,0	13,0	50
PSK 03-1	3	5	1,0	9,5	50
PSK 03-1.5	3	6	1,5	12,5	50
PSK 04-1	4	6	1,0	7,5	50
PSK 04-1.5	4	7	1,5	10,5	50
PSK 04-2	4	8	2,0	12,5	50
PSK 05-1	5	7	1,0	6,0	50
PSK 05-1.5	5	8	1,5	8,5	50
PSK 05-2	5	9	2,0	10,5	50
PSK 05-3.5	5	12	3,5	12,5	50
PSK 06-1	6	8	1,0	5,5	50
PSK 06-1.5	6	9	1,5	7,5	50
PSK 06-2	6	10	2,0	9,5	50
PSK 06-3	6	12	3,0	12,5	50
PSK 07-1	7	9	1,0	4,5	50
PSK 07-1.5	7	10	1,5	6,5	50
PSK 07-2	7	11	2,0	8,5	50
PSK 08-1	8	10	1,0	4,0	50
PSK 08-1.5	8	11	1,5	6,0	50
PSK 08-2	8	12	2,0	7,5	50
PSK 08-3	8	14	3,0	10,5	50
PSK 09-1	9	11	1,0	3,5	50
PSK 09-1.5	9	12	1,5	5,0	50
PSK 09-2	9	13	2,0	6,5	50
PSK 09-2.5	9	14	2,5	7,0	50
PSK 09-3.5	9	16	3,5	10,5	50
PSK 10-1.5	10	13	1,5	4,5	50
PSK 10-2	10	14	2,0	6,0	50
PSK 10-3	10	16	3,0	8,5	50
PSK 11-2	11	15	2,0	5,5	50
PSK 12-1.5	12	15	1,5	4,0	50
PSK 12-2	12	16	2,0	5,0	50
PSK 12-2.5	12	17	2,5	6,5	50
PSK 12-3	12	18	3,0	7,5	50
PSK 13-2	13	17	2,0	5,0	50
PSK 13-3	13	19	3,0	7,0	50
PSK 14-2	14	18	2,0	4,5	50
PSK 14-2.5	14	19	2,5	5,5	50
PSK 14-3	14	20	3,0	6,0	50
PSK 15-2	15	19	2,0	7,5	50
PSK 15-3	15	21	3,0	6,0	50
PSK 16-2	16	20	2,0	4,0	50
PSK 16-2.5	16	21	2,5	5,0	50
PSK 16-3	16	22	3,0	6,0	50
PSK 18-2	18	22	2,0	3,5	50
PSK 18-3	18	24	3,0	5,0	50



Artikli					
Naziv	Unutarnji Ø (mm)	Vanjski Ø (mm)	Debljina stjenki (mm)	BD* kod 20°C (bar)	Duljina valjaka (m)
PSK 19-2.5	19	24	2,5	4,5	50
PSK 19-3	19	25	3,0	5,0	50
PSK 19-3.5	19	26	3,5	5,5	50
PSK 19-4	19	27	4,0	6,5	50
PSK 20-2	20	24	2,0	3,0	50
PSK 20-3	20	26	3,0	4,5	50
PSK 22-3	22	28	3,0	4,5	50
PSK 22-4	22	30	4,0	4,5	50
PSK 24-2	24	28	2,0	2,5	50
PSK 24-3	24	30	3,0	4,0	50
PSK 25-3	25	31	3,0	4,0	50
PSK 25-4	25	33	4,0	5,0	50
PSK 25-4.5	25	34	4,5	5,5	50
PSK 27-3	27	33	3,0	3,5	50
PSK 28-4	28	36	4,0	4,5	50
PSK 30-3.5	30	37	3,5	4,0	50
PSK 30-4	30	38	4,0	4,0	50
PSK 30-4.5	30	39	4,5	4,5	50
PSK 30-5	30	40	5,0	5,0	50
PSK 32-3.5	32	39	3,5	3,0	50
PSK 32-4	32	40	4,0	4,0	50
PSK 32-5	32	42	5,0	5,0	50
PSK 35-3.5	35	42	3,5	3,5	50
PSK 35-5	35	45	5,0	4,5	50
PSK 38-5	38	48	5,0	4,0	50
PSK 40-4	40	48	4,0	3,0	50
PSK 40-5	40	50	5,0	4,0	50
PSK 42-5	42	52	5,0	3,5	50
PSK 45-5	45	55	5,0	3,5	25
PSK 50-5	50	60	5,0	3,0	25
PSK 55-4.5	55	64	4,5	2,5	25
PSK 60-5	60	70	5,0	2,5	25
PSK 65-5	65	75	5,0	2,5	25
PSK 70-5	70	80	5,0	2,5	25
PSK 75-7.5	75	90	7,5	3,4	25
PSK 80-5	80	90	5,0	2,3	25
PSK 90-5	90	100	5,0	2,1	25

BD = radni tlak