


K-FI REG MANO HANSA PRO

Filter regulator, HANSA PRO2 with manual/semi-automatic condensate drain and pressure gauge, HANSA PRO

HANSA FLEX

| Īpašības | |
|---------------------------|---|
| Vielas temperatūra | -10 °C to +50 °C |
| Vides temperatūra | -10 °C to +50 °C |
| Darba vides | Saspiests gaiss |
| Modelis | Diaphragm pressure regulator with relieving, centrifugal filter |
| Stiprinājuma veids | Line mounting, panel mounting, mounting kit or wall mounting |
| Vadība/drošinātājs | lockable handwheel |
| Uzstādīšanas stāvoklis | Vertical, drain down |
| Filtra smalkums | 5,00 µm |
| Manometra pieslēgums | G 1/4 i |
| maks. kondensāta daudzums | 49 cc |
| Nominālā caurplūde G 1/2 | 5.200 l/min (P1 = 10 bar, P2 = 6,3 bar/Delta P = 1 bar) |
| Nominālā caurplūde G 3/8 | 4.300 l/min (P1 = 10 bar, P2 = 6,3 bar/Delta P = 1 bar) |
| PE maks. 4 | Pa 0,5 - 8 bar (Standard)Pa 0,1 - 1 barPa 0,1 - 2 barPa 0,2 - 4 barPa 0,5 - 10 barPa 0,5 - 16 bar |
| PE maks. 6 | 16 bar |
| Filtra elements | Cellpor |
| Korpuss | PA66 |
| Membrāna, blīvējumi | Ms/NBR/PA6 |

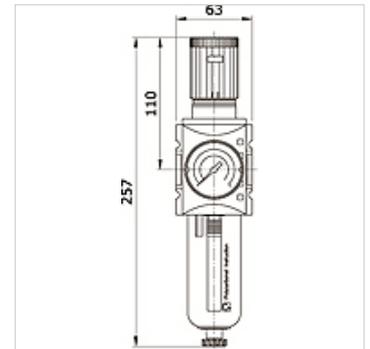

Izstrādājums

| Apzīmējums | Savienojums | Regulēšanas diapazons | Indikācijas diapazoni | Tvertne | Tipizmers | Kondensāta notecē |
|----------------|-------------|-----------------------|-----------------------|------------------------------------|-----------|-------------------------|
| K- 07 25 21 60 | G 3/8 i | 0.1 - 1 bar | 0 - 1,6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 61 | G 3/8 i | 0.1 - 2 bar | 0 - 2,5 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 62 | G 3/8 i | 0.2 - 4 bar | 0 - 6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 63 | G 3/8 i | 0.5 - 8 bar | 0 - 10 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 64 | G 3/8 i | 0.5 - 10 bar | 0 - 16 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 65 | G 3/8 i | 0.5 - 16 bar | 0 - 25 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 66 | G 1/2 i | 0.1 - 1 bar | 0 - 1,6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 67 | G 1/2 i | 0.1 - 2 bar | 0 - 2,5 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 68 | G 1/2 i | 0.2 - 4 bar | 0 - 6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 69 | G 1/2 i | 0.5 - 8 bar | 0 - 10 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 70 | G 1/2 i | 0.5 - 10 bar | 0 - 16 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 71 | G 1/2 i | 0.5 - 16 bar | 0 - 25 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 21 72 | G 3/8 i | 0.1 - 1 bar | 0 - 1,6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 73 | G 3/8 i | 0.1 - 2 bar | 0 - 2,5 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 74 | G 3/8 i | 0.2 - 4 bar | 0 - 6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 75 | G 3/8 i | 0.5 - 8 bar | 0 - 10 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 76 | G 3/8 i | 0.5 - 10 bar | 0 - 16 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 77 | G 3/8 i | 0.5 - 16 bar | 0 - 25 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 78 | G 1/2 i | 0.1 - 1 bar | 0 - 1,6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 79 | G 1/2 i | 0.1 - 2 bar | 0 - 2,5 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 80 | G 1/2 i | 0.2 - 4 bar | 0 - 6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 81 | G 1/2 i | 0.5 - 8 bar | 0 - 10 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 82 | G 1/2 i | 0.5 - 10 bar | 0 - 16 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 21 83 | G 1/2 i | 0.5 - 16 bar | 0 - 25 bar | zinc with visual display | 2 | manual / semi-automatic |