


K-WTEH 3-TEILIG HANSA PRO

3-part service unit, with manual/semi-automatic condensate drain and pressure gauge, HANSA PRO

HANSA FLEX

| Lastnosti | |
|----------------------------------|--|
| izhodni tlak | Pa 0,5 - 8 bar (Standart) Pa 0,1 - 1 bar Pa 0,1 - 2 bar Pa 0,2 - 4 bar Pa 0,5 - 10 bar Pa 0,5 - 16 bar |
| temperatura medija | -10 °C to +50 °C |
| temperatura okolice | -10 °C to +50 °C |
| Sredstva | stisnjen zrak |
| Način izdelave | Centrifugal filter membrane pressure regulator with relieving, fog lubricator |
| vrsta pritrditve | Line mounting, panel mounting, mounting kit or wall mounting |
| sprožitev / varovalka | lockable handwheel |
| Vgradna lega | Vertical, drain down |
| finoča filtra | 5,00 µm |
| priključek manometra | G 1/4 i |
| maks. količina kondenzata | 49 cc |
| maks. količina olja | 80 cc |
| nazivni pretok G 1/2 | 3.500 l/min (P1 = 10 bar, P2 = 6,3 bar/Delta P = 1 bar) |
| nazivni pretok G 3/8 | 3.500 l/min (P1 = 10 bar, P2 = 6,3 bar/Delta P = 1 bar) |
| doziranje olja pri qv=1000 l/min | 1-2 drops / min (guideline) |
| PE maks. 12 | 16 bar |
| filtrirni element | Cellpor |
| ohišje | PA66 |
| membrana, tesnila | Ms/NBR/PA6 |
| kapalni nastavek | Polycarbonate |
| vrsta olja | CL 32 acc. to DIN 51517 - ISO VG 32 |

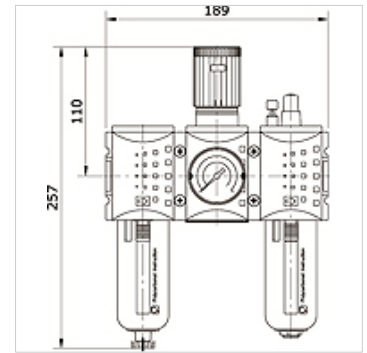

Artikel

| Opis | Priključek | regulacijsko območje | območja prikaza | posoda | Velikost | izpust kondenzata |
|----------------|------------|----------------------|-----------------|------------------------------------|----------|-------------------------|
| K- 07 25 22 12 | G 3/8 i | 0.1 - 1 bar | 0 - 1,6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 13 | G 3/8 i | 0.1 - 2 bar | 0 - 2,5 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 14 | G 3/8 i | 0.2 - 4 bar | 0 - 6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 15 | G 3/8 i | 0.5 - 8 bar | 0 - 10 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 16 | G 3/8 i | 0.5 - 10 bar | 0 - 16 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 17 | G 3/8 i | 0.5 - 16 bar | 0 - 25 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 18 | G 1/2 i | 0.1 - 1 bar | 0 - 1,6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 19 | G 1/2 i | 0.1 - 2 bar | 0 - 2,5 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 20 | G 1/2 i | 0.2 - 4 bar | 0 - 6 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 21 | G 1/2 i | 0.5 - 8 bar | 0 - 10 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 22 | G 1/2 i | 0.5 - 10 bar | 0 - 16 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 23 | G 1/2 i | 0.5 - 16 bar | 0 - 25 bar | polycarbonate with protective cage | 2 | manual / semi-automatic |
| K- 07 25 22 24 | G 3/8 i | 0.1 - 1 bar | 0 - 1,6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 25 | G 3/8 i | 0.1 - 2 bar | 0 - 2,5 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 26 | G 3/8 i | 0.2 - 4 bar | 0 - 6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 27 | G 3/8 i | 0.5 - 8 bar | 0 - 10 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 28 | G 3/8 i | 0.5 - 10 bar | 0 - 16 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 29 | G 3/8 i | 0.5 - 16 bar | 0 - 25 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 30 | G 1/2 i | 0.1 - 1 bar | 0 - 1,6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 31 | G 1/2 i | 0.1 - 2 bar | 0 - 2,5 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 32 | G 1/2 i | 0.2 - 4 bar | 0 - 6 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 33 | G 1/2 i | 0.5 - 8 bar | 0 - 10 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 34 | G 1/2 i | 0.5 - 10 bar | 0 - 16 bar | zinc with visual display | 2 | manual / semi-automatic |
| K- 07 25 22 35 | G 1/2 i | 0.5 - 16 bar | 0 - 25 bar | zinc with visual display | 2 | manual / semi-automatic |